

3500W 尺寸图与性能表

3500W DIMENSIONAL DRAWING & PERFORMANCE TABLE

■ 性能表 Performance Table (输入转速为3,000rpm时 When input speed is 3000rpm)

额定输入 马达功率 Rated input motor	减速比 Reduction ratio	型号 Type			输出轴 转速 Output shaft speed (rpm)	额定输出 扭矩 Standard output torque (N·m)	瞬间最大 输出扭矩 Instantaneous max. output torque (N·m)	容许径向 负荷 Permissible radial load (N)	容许轴向 负荷 Permissible axial load (N)	输入轴换算 内部惯性力矩 Internal moment of inertia of input shaft conversion (10 ⁻⁴ ×kg·m ²)	容许输出 扭矩 Permissible output torque (N·m)	瞬间最大容 许输出扭矩 Instantaneous max. permissible output torque (N·m)	
		机种 Model	减速比 Reduction ratio	段位号 Type no.									马达功率 Motor
3500W	1/3	VRSF	3	E	3500	1000	28.3	85.2	1370	686	5.50	44.1	132
	1/5	VRSF	5	E	3500	600	47.2	141	1670	833	3.48	56.8	171

注1) 安装基准机种 (马达适用表记载系列) 以外的马达时, 每次都要与我们联系。(法兰尺寸可能不同)

注2) 输入轴换算惯性力矩仅为减速机的数值, 不包括马达的惯性力矩。

注3) 最高输入转速为5000rpm。正常情况下请转速控制在3000rpm以下。

注4) 容许径向负荷表示输出轴中央部位的值。

注5) 全部为斜齿轮适用范围。

注6) 马达的安装顺序请参照P.46

注7) 输出轴旋转方向与马达输入旋转方向相同。

Note 1) In case of attachment to a motor beyond the standard models(motor matching series), contact us.(How to measure dimensions of the flange may be changed in some cases.)

Note 2) The moment of inertia of input shaft conversion is only gained from the reducer, so it does not include moment of inertia of the motor.

Note 3) The max. input speed is 5000rpm, and usually set to 3000rpm or less.

Note 4) The permissible radial load is indicated on the center of the output shaft.


Note 5) All values are within the range corresponding to helical gear.

Note 6) For motor assembly procedure, see 46 page.

Note 7) Rotation of the output shaft is in the same direction as motor.

■ 尺寸图 Dimensional Drawing

VRSF-3E-5E-3500

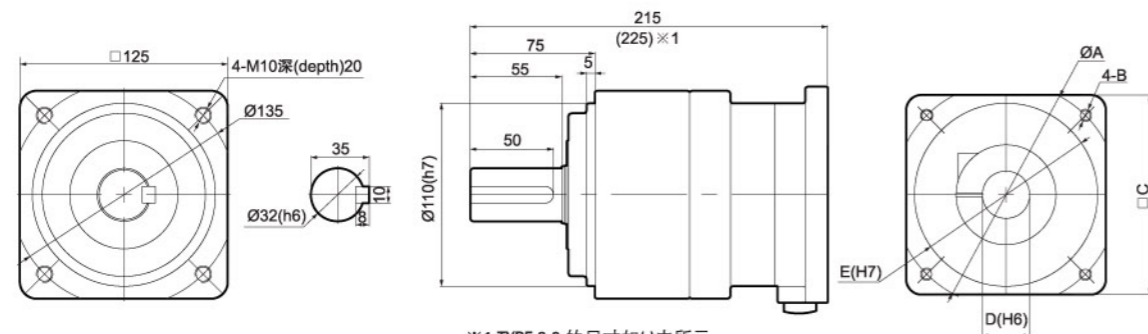

※1 TYPE 2-3 的尺寸如 () 内所示

※1 TYPE 2-3 has the numerical value indicated in ().

■ 法兰部位详细尺寸表 Detailed flange dimensions table (单位Unit: mm)

马达种类 Motor type	A	B	C	D	E
TYPE 1	130	M8	120	22	110
TYPE 2	-	-	-	-	-
TYPE 3	145	M8	130	28	110

● 概略重量 12.0kg

● Rough weight 12.0kg

● TYPE1~3 的详细情况请参照 P.45

● For details of TYPE1~3, see 45 page.

4000W 尺寸图与性能表

4000W DIMENSIONAL DRAWING & PERFORMANCE TABLE

■ 性能表 Performance Table (输入转速为3,000rpm时 When input speed is 3000rpm)

额定输入 马达功率 Rated input motor	减速比 Reduction ratio	型号 Type			输出轴 转速 Output shaft speed (rpm)	额定输出 扭矩 Standard output torque (N·m)	瞬间最大 输出扭矩 Instantaneous max. output torque (N·m)	容许径向 负荷 Permissible radial load (N)	容许轴向 负荷 Permissible axial load (N)	输入轴换算 内部惯性力矩 Internal moment of inertia of input shaft conversion (10 ⁻⁴ ×kg·m ²)	容许输出 扭矩 Permissible output torque (N·m)	瞬间最大容 许输出扭矩 Instantaneous max. permissible output torque (N·m)	
		机种 Model	减速比 Reduction ratio	段位号 Type no.									马达功率 Motor
4000W	1/3	VRSF	3	E	4000	1000	33.1	99.0	1370	686	5.78	44.1	132
	1/5	VRSF	5	E	4000	600	55.3	166	1670	833	3.75	56.8	171

注1) 安装基准机种 (马达适用表记载系列) 以外的马达时, 每次都要与我们联系。(法兰尺寸可能不同)

注2) 输入轴换算惯性力矩仅为减速机的数值, 不包括马达的惯性力矩。

注3) 最高输入转速为5000rpm。正常情况下请转速控制在3000rpm以下。

注4) 容许径向负荷表示输出轴中央部位的值。

注5) 全部为斜齿轮适用范围。

注6) 马达的安装顺序请参照P.46

注7) 输出轴旋转方向与马达输入旋转方向相同。

Note 1) In case of attachment to a motor beyond the standard models(motor matching series), contact us.(How to measure dimensions of the flange may be changed in some cases.)

Note 2) The moment of inertia of input shaft conversion is only gained from the reducer, so it does not include moment of inertia of the motor.

Note 3) The max. input speed is 5000rpm, and usually set to 3000rpm or less.

Note 4) The permissible radial load is indicated on the center of the output shaft.


Note 5) All values are within the range corresponding to helical gear.

Note 6) For motor assembly procedure, see 46 page.

Note 7) Rotation of the output shaft is in the same direction as motor.

■ 尺寸图 Dimensional Drawing

VRSF-3E-5E-4000

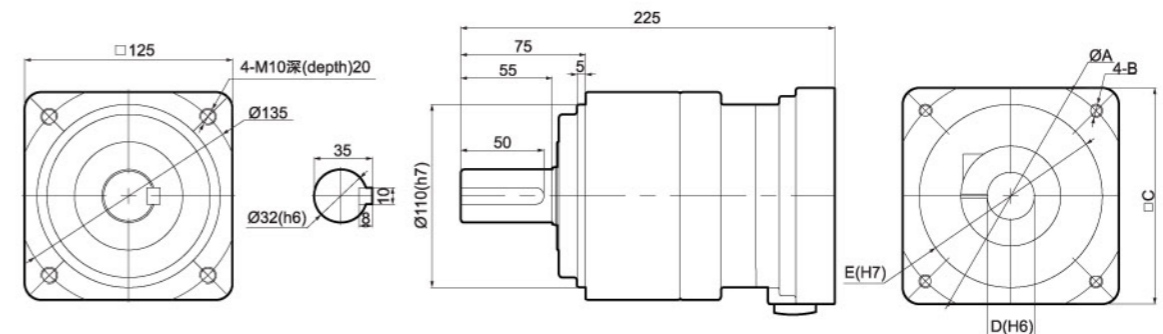

■ 法兰部位详细尺寸表 Detailed flange dimensions table (单位Unit: mm)

马达种类 Motor type	A	B	C	D	E
TYPE 1	145	M8	130	24	110
TYPE 2	145	M8	130	28	110
TYPE 3	-	-	-	-	-

● 概略重量 13.0kg

● Rough weight 13.0kg

● TYPE1~2 的详细情况请参照 P.45

● For details of TYPE1~2, see 45 page.